

# Revisions

This page lists any assembly remarks and issues with each revision of the board.

## Rev 1

- 5V power module (U302) sync input should be grounded, to use internal sync.  
image-1644815113713.46.png
- Move capacitors out from under the 5V power module; it causes interference issues
- Annular rings on power module need to be wider (at least by .2mm;) they suck to solder to right now
- R201/R202 (100k pulldown on audio inputs) are redundant; they are already at the opamp (R105/R106)
- D401 sucks to hand solder (super tiny)
- Volume potentiometer RV101 should be logarithmic type

---

Revision #3

Created 14 February 2022 05:03:13

Updated 2 March 2022 07:59:27